

Technical Bulletin

Technical Helpline: +44(0)1622 833004 Fax: +44(0)1622 834004

ADZ93501C Dual Mass Flywheel Fitment Guide

Date Issued: 07/2009

Application Isuzu Trooper 3.0DT 01/98 to 04/06



We have identified an issue when fitting part number **ADZ93501C** Dual Mass flywheel.

If the flywheel is not fitted in the correct position, this will cause problems with the engine management system and the vehicle will not start.

Important Information

1. Thoroughly clean the flywheel fixing surface.
2. Set crankshaft to TDC (Top Dead Centre).
3. Mount flywheel so the cut out (Timing mark) on the flywheel is set to the 6 o'clock position.
4. Tighten the flywheel bolts in 2 steps using angular tightening method.

Torque (1st step = 60Nm)
(2nd step = 60° - 90°)

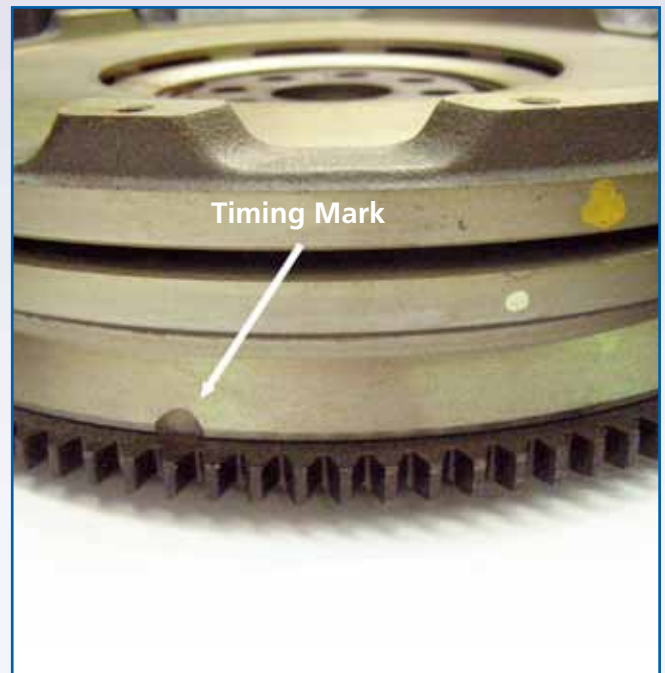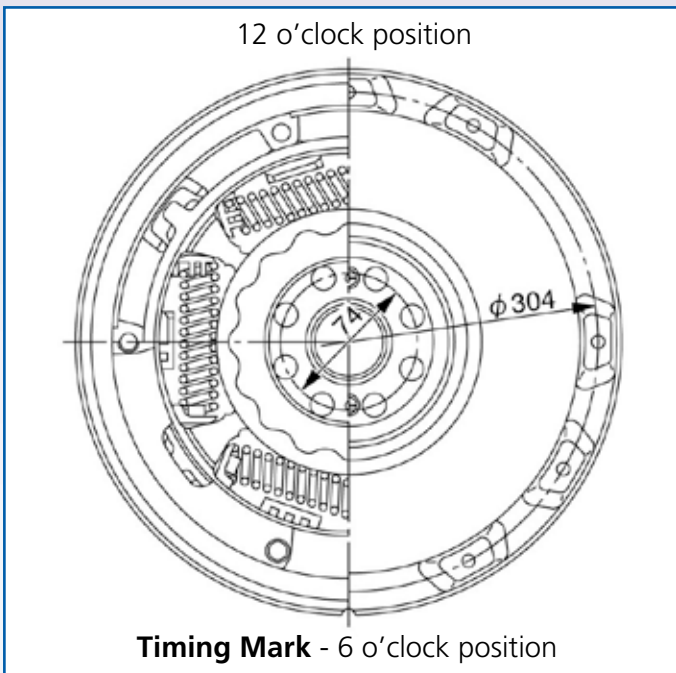

Disclaimer : Any technical tips are produced in good faith. Blue Print, always recommend that vehicle maintenance and diagnostics are only carried out by suitably experienced people using appropriate tools in a safe manner within a workshop environment. Blue Print, and their customers cannot be held responsible for the correctness of, or misinterpretation of the above technical tips. Images shown are for illustrative purposes only and may not be representative of the products or vehicles described.