



Opel

Vectra B model year: 1996-2000

Zafira model year: 1999-2000

Astra G model year: 1998-1999

With engine code: X18XE1, X16SZR

Engine judders, fault code P0400 / P1405

If with the above models the engine should judder when at a constant speed (40-80 km/h), at accelerations up to 3000 min⁻¹, or when the accelerator pedal is released, this may be due to a faulty exhaust gas recirculation valve (EGR valve). At the same time, the code P0400 (exhaust gas recirculation rate), or P1405 (EGR valve, faulty function), is stored in the fault memory. The above-mentioned symptoms occur in particular with the following Delphi EGR valves:

Part no: 98055

Production date: 1995, 1996, 1997, 1998,

1st day up to and including 242nd day of 1999

Identification:


Part no: (Item 1)

Production date: (Item 2)

Digits 1-3 = day

Digit 4 = year

Digit 5 = not relevant

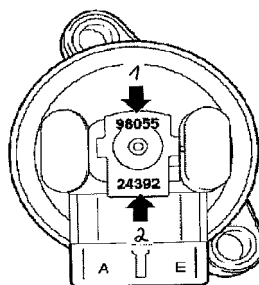

If the above-mentioned criteria apply, and the electrical connection of the EGR valve is not faulty, the valve should be replaced and the fault memory erased.