



# febi 32418, 103186

**To Fit:**

Ford, Mazda and Volvo (various models)



EN

## Control Arm Bush

**Problem**

Uneven tyre wear and misalignment of the front suspension.

**Cause**

The lower suspension control arm bush is worn.


**Solution**

febi provides an economical repair solution whereby the control arm bush can be replaced instead of the complete suspension control arm.

When replacing this bush it is important that the alignment of the original control arm bush is followed.

If the bush is not aligned correctly on the shaft of the suspension arm then there is a risk of premature failure and a shortened lifetime of the component.

**Note:** There is a special tool available from the vehicle manufacturer to assist in the replacement of the control arm bush. By using this tool it can be ensured that the installation position and press-fit depth of the bush will be correct.

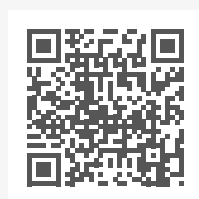

Scan the QR code to watch the febi control arm bush kit replacement video or watch it online at:

[youtube.com/ferdinandbilstein](https://www.youtube.com/ferdinandbilstein)

For more technical information please visit: [partsfinder.bilsteingroup.com](https://www.partsfinder.bilsteingroup.com)